

A Safety Gate home (https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

■ Back to report listings (https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=er

Q Search alerts (https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&Ing=en)

■ IPSW 2018 (https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

Week 5 - 2019

Alert number: A12/0189/19

Product: Self-balancing scooter (hoverboard)

Name: City Board SUV - Hoverboard

Risk type: Burns, Fire

Category: Hobby/sports equipment

Brand: GOCLEVER

Type / number of model: CBLSSBEU Black with LG battery

Type of alert: Products with serious risks

The hoverboard's charging circuit has no cut-off switch. The battery can consequently overcharge and overheat which could lead to a fire.

In addition, the plastic housing of the hoverboard can easily catch fire.

The product does not comply with the requirements of the Machinery Directive and the relevant European Standards EN 60335-1 and EN 62133-2.

Withdrawal of the product from the market

Description: 2-wheel, electric self-balancing scooter (hoverboard), including instructions and charger. Packaged in a rectangular cardboard box.

Batch number / Barcode: 5906736072463

Country of origin: China

Alert submitted by: The Netherlands







Alert number: A12/0190/19

Product: Self-balancing scooter/Hoverboard

Name: Balance scooter Risk type: Burns, Fire

Category: Hobby/sports equipment

Brand: Denver

Type / number of model: Scooter: DBO-6501 WHITE MK2 Power charger: JY-420150

Type of alert: Products with serious risks

The charging circuit of the product has no cut-off switch.

The battery can consequently overcharge and overheat which may lead to a fire. Furthermore, the plastic housing of the hoverboard can easily

catch fire

The product does not comply with the requirements of the Machinery Directive and the relevant European Standard EN 60335-1.

Warning consumers of the risks, Withdrawal of the product from the market

Description: 2 wheel self-balancing scooter (hoverboard), including instructions and charger. Charger Input: 100-240V~ Output: DC 42V.

Packaged in a rectangular cardboard box marked with a picture of the product.

Batch number / Barcode: 5706751035494

Country of origin: Denmark

Alert submitted by: The Netherlands

Products were found and measures were taken also in: Luxembourg





Alert number: A12/0172/19 Product: Tattoo ink Name: ROSA - HOT PINK Risk type: Chemical

Category: Chemical products

Brand: Eternal Ink

Type / number of model: Unknown
Type of alert: Products with serious risks

The product contains the aromatic amine o-anisidine (measured value: 26 mg/kg). This aromatic amine can cause cancer, cell mutations and affect reproduction.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that aromatic amines with carcinogenic mutagenic, reprotoxic or sensitising properties should neither be present in tattoos and permanent make-up products nor released from azo-colourants.

Ban on the marketing of the product and any accompanying measures

Description: Bottle of red tattoo ink

Batch number / Barcode: Batch number 02/09/16

Country of origin: United States

Alert submitted by: Italy



Alert number: A12/0174/19 Product: Tattoo ink Name: CARAMEL Risk type: Chemical

Category: Chemical products

Brand: Eternal Ink

Type / number of model: Unknown Type of alert: Products with serious risks

The product contains the aromatic amines o-anisidine (measured value 74 mg/kg) and o-toluidine (measured value 67 mg/kg).

Aromatic amines can cause cancer, cell mutations and affect reproduction.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that aromatic amines with carcinogenic, mutagenic, reprotoxic or sensitising properties should neither be present in tattoos and permanent makeup products nor released from azo-colourants.

Ban on the marketing of the product and any accompanying measures

Description: 30 ml bottle with brown tattoo ink.

Batch number / Barcode: batch R-136, expiry date 06/2020

Country of origin: United States Alert submitted by: Italy





Alert number: A12/0179/19 **Product**: Novelty lighter

Name: Butane gas lighters - coke bottle

Risk type: Burns, Fire Category: Lighters Brand: Unknown

Type / number of model: Unknown
Type of alert: Products with serious risks

The lighter is appealing to children due to its shape and colour. Children may play with it and suffer burns or cause a fire.

The product does not comply with the relevant European standard EN 13869.

Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market

Description: Novelty lighter in imitation of a Pepsi cola bottle. The product has been sold online (in particular via Cdiscount).

Batch number / Barcode: Unknown THE PRODUCT IS COUNTERFEIT Country of origin: Unknown Alert submitted by: France



Alert number: A12/0180/19 **Product:** Novelty lighter

Name: Refillable butane gas lighter in the form of a lip

Risk type: Burns, Fire Category: Lighters Brand: Unknown

Type / number of model: Unknown
Type of alert: Products with serious risks

The lighter is appealing to children, due to its shape and colour. Children may play with it and suffer burns or cause a fire.

The product does not comply with the relevant European standard EN 13869.

Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market

Description: Lighter in the form of a pink lipstick with white dots. The product was sold online (in particular via Cdiscount).

Batch number / Barcode: Unknown Country of origin: Unknown Alert submitted by: France

Products were found and measures were taken also in: Austria



Alert number: A12/0181/19 **Product**: Novelty lighter

Name: Accessories - butane gas lighter-fire-extinguisher

Risk type: Burns, Fire Category: Lighters Brand: Unknown

Type / number of model: Unknown
Type of alert: Products with serious risks

The lighter is appealing to children due to its shape and colour. Children may play with it and suffer burns or cause a fire.

The product does not comply with the relevant European standard EN 13869.

Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market

Description: Lighter in the form of a fire-extinguisher with white label. The product was sold online (in particular via Cdiscount).

Batch number / Barcode: Unknown Country of origin: Unknown Alert submitted by: France



Alert number: A12/0158/19 Product: Passenger car Name: Escalade Risk type: Injuries Category: Motor vehicles

Brand: Cadillac

Type / number of model: Type-approval number: e13*2007/46*1479*00 Type: K2XX

Type of alert: Products with serious risks

The software is faulty which may lead to sporadic failure of the electric power steering.

The driver might consequently lose control of the vehicle.

Recall of the product from end users

Description: Passenger car. Company recall code: 18289EU

Batch number / Barcode: The vehicles concerned were manufactured in 2015.

Country of origin: United States
Alert submitted by: Germany

Products were found and measures were taken also in: Luxembourg, Sweden, The Netherlands

Alert number: A12/0159/19 Product: Motorcycle

Name: Tricity, MWS125, MWS125A, MWS150A

Risk type: Injuries Category: Motor vehicles Brand: Yamaha

Type / number of model: Type-approval number: e13*168/2013*00049 Type: SEC 2

Type of alert: Products with serious risks

Poor material resistance of the hoses in the area of the cooling water expansion tank can lead to the loss of cooling water.

The cooling liquid could leak onto the road and the rider could consequently lose control of the motorcycle.

Recall of the product from end users

Description: Motorcycle.

Batch number / Barcode: The vehicles concerned were produced between 2017 and 2018.

Country of origin: Thailand
Alert submitted by: Germany

Products were found and measures were taken also in: Croatia, Finland, Luxembourg, Poland, Slovenia, The Netherlands

Alert number: A12/0160/19 Product: Passenger car Name: Touareg Risk type: Injuries Category: Motor vehicles

 $\textbf{Brand:}\ \forall W$

Type / number of model: Type-approval number: e1*2007/46*1827*; Type: CR

Type of alert: Products with serious risks

A seat-belt latch may not have been sufficiently secured to the rear, right-hand seat.

In the event of an accident, the rear seat-belt latch may therefore break, increasing the risk of injuries to passengers.

Recall of the product from end users

Description: Passenger car. Company recall code: 69Y2

Batch number / Barcode: The vehicles in question were produced between 8/8/2018 and 5/10/2018.

Country of origin: Germany
Alert submitted by: Germany

Products were found and measures were taken also in: Bulgaria, Croatia, Denmark, Finland, Hungary, Ireland, Luxembourg, Slovenia,

Sweden, The Netherlands

Alert number: A12/0161/19 Product: Passenger Car Name: Mulsanne Risk type: Injuries Category: Motor vehicles

Brand: Bentley

Type / number of model: Type approval numbers: e11*KS07/46*0116*00, e11*KS07/46*0116*01, e11*KS07/46*0116*02, e11*KS07/46*0116*03,

e11*KS07/46*0116*04, e11*KS07/46*0116*05 **Type of alert:** Products with serious risks

The body mounting panels of the rear seatbelt buckle anchorages have been made using an incorrect grade of material.

In the event of an impact accident, if the rear centre seat is occupied at the same time as an outer rear seat, the rear seatbelt buckle may become detached from the bodywork, leading to injuries.

Recall of the product from end users

Description: Passenger car under Bentley Motors Limited recall code RE19/01 (RB15).

Batch number / Barcode: The affected vehicles were manufactured between 08/03/2012 and 21/07/2018

Country of origin: United Kingdom
Alert submitted by: United Kingdom

Products were found and measures were taken also in: Denmark, Sweden

Alert number: A12/0162/19 Product: Passenger car

Name: A-class
Risk type: Injuries
Category: Motor vehicles
Brand: Mercedes-Benz

Type / number of model: Type-approval number: e1*2007/46*1829*03; Type: F2A

Type of alert: Products with serious risks

No perforation has been made in the outer covering of the instrument panel to enable the deployment of the passenger airbag.

In the event of an accident involving deployment of the airbag at low temperatures, sharp edges could be created on the instrument panel in the airbag's deployment area, damaging the airbag. Moreover, parts of the instrument panel may become detached, increasing the risk of injury to the occupants.

Recall of the product from end users

Description: Passenger car. Company recall code: 6890001

Batch number / Barcode: The vehicles in question were manufactured between 13/11/2017 and 22/08/2018.

Country of origin: Germany
Alert submitted by: Germany

Products were found and measures were taken also in: Poland

Alert number: A12/0163/19 Product: Passenger car Name: C-class, GLC Risk type: Injuries Category: Motor vehicles Brand: Mercedes-Benz

Type / number of model: EC type approvals: e1*2001/116*0480*23-30, e1*2007/46*1884*00, e1*2001/116*0431*48-50, e1*2001/116*0457*35-

41, e1*2001/116*0463*20, e1*2001/116*0464*22 Types: 204, -X, -X AMG, -K, -K AMG, -AMG

Type of alert: Products with serious risks

In vehicles with automatic child-seat detection, the status shown in the centre console of the passenger airbags may not be correctly indicated. In this case, the vehicle users would not be correctly informed of the actual activation status of the passenger airbag and may not react appropriately to a potentially false passenger classification, thereby increasing the risk of injury for passengers in the event of an accident.

Recall of the product from end users

Description: Passenger car. Company recall code: 8295004.

Batch number / Barcode: The vehicles in question were manufactured between 1 August 2017 and 11 October 2018.

Country of origin: Germany
Alert submitted by: Germany

Products were found and measures were taken also in: Denmark, Finland, Iceland, Luxembourg, Poland, Romania, Slovakia, Slovenia

Alert number: A12/0164/19 Product: Passenger car Name: C-class, E-class, CLS

Risk type: Injuries
Category: Motor vehicles
Brand: Mercedes-Benz

Type / number of model: EC type-approvals: e1*2001/116*0431, e1*2001/116*0457, e1*2001/116*0501, e1*2007/46*1560, e1*2007/46*1818, e1*2001/116*0464, e1*2001/116*0463, e1*2007/46*1666*08, Types: 204, 204 K, 212, R1ES, R1ECLS, 204 AMG, 204 K AMG, R1EC

Type of alert: Products with serious risks

There may be cracks in a securing nut in the steering gear of rear-wheel-drive vehicles.

The nut could consequently break if the steering system is subject to a very high lateral force, which could result in rotating parts in the steering gear affecting the casing and thereby blocking the steering system.

Recall of the product from end users

Description: Passenger car. Company recall code: 4693003.

Batch number / Barcode: The vehicles in question were produced between 14 February 2014 and 16 December 2018.

Country of origin: Germany
Alert submitted by: Germany

Products were found and measures were taken also in: Iceland, Luxembourg, Poland, Romania

Alert number: A12/0167/19

Product: Lorry Name: eCanter

Risk type: Burns, Fire, Injuries Category: Motor vehicles Brand: Mitsubishi Fuso

Type / number of model: Type-approval number: E4*2007/46*0785*; Type: FE4P10TF1N2

Type of alert: Products with serious risks

Owing to a defective power distribution unit (PDU), short circuits in the vehicle electronics may occur. Increased resistance or a power interruption

may occur and/or, where currents are high, a thermal event may ensue.

This could lead to the vehicle breaking down or catching fire.

Recall of the product from end users

Description: Lorry

Batch number / Barcode: The vehicles concerned were produced between September 2017 and December 2017.

Country of origin: Germany
Alert submitted by: Germany

Alert number: A12/0170/19

Product: Tyres

Name: Winter Contact TS860

Risk type: Injuries
Category: Motor vehicles
Brand: Continental

Type / number of model: ECE type approvals: R30: E4 0289778; R117: E4 027400 S2WR2

Type of alert: Products with serious risks Loosening of the tread could occur.

This could have an adverse effect on the handling and stability of the vehicle.

Recall of the product from end users

Description: Tyres

Batch number / Barcode: This concerns one week of the manufacturing year 2018 identified by the following code: DOT 6GAED29W4118.

Country of origin: Romania

Alert submitted by: Germany

Products were found and measures were taken also in: Poland

Alert number: A12/0171/19

Product: Tyres
Name: MS Plus 77
Risk type: Injuries
Category: Motor vehicles
Brand: Uniroyal

Type / number of model: ECE type approvals: R30: E4 0268280; R117: E4 025045 S2WR2

Type of alert: Products with serious risks Loosening of the tread could occur.

This could have an adverse effect on the handling and stability of the vehicle.

Recall of the product from end users

Description: Tyres

Batch number / Barcode: This concerns one week of the manufacturing year 2018 identified by the following code: DOT 6GXWDDBR4118.

Country of origin: Romania

Alert submitted by: Germany

Alert number: A12/0175/19 Product: Passenger car Name: Cherokee, Compass Risk type: Injuries

Category: Motor vehicles

Brand: Jeep

 $\textbf{Type / number of model:} \ \ \mathsf{EC} \ \ \mathsf{type-approvals:} \ \ \mathsf{e4*2007/46*0783*11}, \ \mathsf{e11*2007/46*4037*02}; \ \ \mathsf{Types:} \ \mathsf{KL}, \ \mathsf{MX} \\ \mathsf{$

Type of alert: Products with serious risks

Incorrect coating of the brake pistons can result in the formation of gas in the hydraulic system.

This may adversely affect the functioning of the brakes on the rear-axle wheels.

Recall of the product from end users

Description: Passenger car. Recall code: U86

Batch number / Barcode: The vehicles concerned were produced between 17 March 2018 and 21 June 2018.

Country of origin: United States
Alert submitted by: Germany

Products were found and measures were taken also in: Croatia, Denmark, Finland, Hungary, Luxembourg, Poland, Slovenia, Sweden, The

Netherlands

Alert number: A12/0176/19 **Product:** Passenger car

Name: Stelvio Risk type: Fire

Category: Motor vehicles Brand: Alfa Romeo

Type / number of model: EC type-approval: e3*2007/46*0435*02; Type: 949; sales description: Stelvio

Type of alert: Products with serious risks

A non-compliant generator cable may be damaged as a result of contact with the exhaust gas recirculation line.

This could cause a short-circuit and in the worst case fire in the engine compartment.

Recall of the product from end users

Description: Passenger car. Recall code: 8228.

Batch number / Barcode: The vehicles concerned were produced between 18 January 2017 and 18 September 2018.

Country of origin: Italy
Alert submitted by: Germany

Products were found and measures were taken also in: Bulgaria, Croatia, Denmark, Finland, Hungary, Iceland, Luxembourg, Poland,

Slovenia, Sweden, The Netherlands

Alert number: A12/0177/19

Product: Lorry
Name: Econic
Risk type: Injuries
Category: Motor vehicles
Brand: Mercedes-Benz

Type / number of model: Type-approval number: e1*2007/46*1221* Type: NGE-L64

Type of alert: Products with serious risks

Pneumatic brake lines on the parking brake may, under certain conditions, be damaged by chafing on the drive shafts when the vehicle is lowered

to the lowest position.

As a result, it could, over time, cause the wheels to jam when applying the brakes.

Recall of the product from end users

Description: Lorry

Batch number / Barcode: The vehicles in question were manufactured between 1 October 2013 and 26 July 2018.

Country of origin: Germany
Alert submitted by: Germany

Alert number: A12/0178/19 Product: Vehicle component

Name: KLK HE 1200-22; KLK HE 1300-22

Risk type: Injuries
Category: Motor vehicles

Brand: JOST

Type / number of model: Unknown
Type of alert: Products with serious risks

Owing to a defect in the continuous steel casting process, the ball-bearing turntables may break.

Consequently, the connection to the lower turntable of a trailer may be lost, which could lead to an accident.

Recall of the product from end users

Company recall page: https://www.jost-klk.com/en/ (https://www.jost-klk.com/en/)

Description: Vehicle part (ball-bearing turntables used to connect trailers) .

Batch number / Barcode: Period of manufacture: December 2016 to 16.11.2018.

Country of origin: Hungary
Alert submitted by: Germany

Products were found and measures were taken also in: Croatia

Alert number: A12/0183/19 Product: Passenger car

Name: Zafira Risk type: Fire

Category: Motor vehicles

Brand: Opel

Type / number of model: Type-approval numbers: e1*2001/116*0325*00-11, e1*2007/46*0497*00-05 Type: A-H/monocab

Type of alert: Products with serious risks
There is a defective regulator on the blower motor.

This can cause a fire in the cable set.

Recall of the product from end users

Description: Passenger car. Company recall code: E162078570 (18-C-019).

Batch number / Barcode: The vehicles concerned were manufactured between 2 November 2004 and 24 October 2014.

Country of origin: Germany
Alert submitted by: Germany

Products were found and measures were taken also in: The Netherlands

Alert number: A12/0185/19
Product: Passenger Car

Name: Range Rover, Sport, Velar, Discovery

Risk type: Injuries
Category: Motor vehicles
Brand: Land Rover

Type / number of model: Range Rover E11*2007/46*0649 Range Rover Sport E11*2007/46*0909 Range Rover Velar E11*2007/46*3954

Discovery E11*2007/46*3784

Type of alert: Products with serious risks
The crankshaft pulley retaining bolt may fracture.

As a consequence, the crankshaft nose could break leading to engine power loss and the potential for engine failure. Furthermore, the loose

pulley could damage under bonnet components or puncture the bonnet and become a hazard to pedestrians or other road users.

Recall of the product from end users

Description: Passenger car

Batch number / Barcode: Specific vehicles built between 10/10/2018 and 19/12/2018

Country of origin: United Kingdom

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Bulgaria, Denmark, Poland

Alert number: A12/0188/19 Product: Passenger car

Name: 991 Carrera, Cayenne, Macan, Panamera

Risk type: Injuries
Category: Motor vehicles

Brand: Porsche

 $\textbf{Type / number of model:} \ \ \, \textbf{Type-approval numbers: se13*2007/46*1187 e13*2007/46*1085* e13*2007/46*1106* e13*2007/46*1107* e13*2007/46*1108* e13*2007/46*1164* e13*2007/46*0970* e13*2007/46*1143* e13*2007/46*1160* , e13*2007/46*1161*; types: 991, 92A, e13*2007/46*1161* e$

95B, 970;

Type of alert: Products with serious risks

It is possible that the vehicles do not meet the series standards applicable at the time of delivery as regards certain safety systems and assemblies (e.g. seating, front axle control arm bolts, brake components).

As a consequence, the cars might be unsafe.

Recall of the product from end users

Description: Passenger car. Company recall code AH11.

Batch number / Barcode: The vehicles concerned were produced in 2014 and 2015

Country of origin: Germany
Alert submitted by: Germany

Products were found and measures were taken also in: Bulgaria

Alert number: A12/0192/19 Product: Passenger car Name: F-Pace, F-Type, XJ Risk type: Injuries Category: Motor vehicles

Brand: Jaguar

Type / number of model: F-PACE E11*2007/46*3324 F-TYPE E11*2001/116*0272 XJ E11*2007/46*0089

Type of alert: Products with serious risks
The crankshaft pulley retaining bolt may fracture.

As a consequence, the crankshaft nose could break leading to engine power loss and the potential for engine failure. Furthermore, the loose pulley could damage under bonnet components or puncture the bonnet and become a hazard to pedestrians or other road users.

Recall of the product from end users **Description:** Passenger car.

Batch number / Barcode: Specific vehicles built between 12/10/2018 and 11/12/2018

Country of origin: United Kingdom
Alert submitted by: United Kingdom

Alert number: A12/0193/19 **Product:** Passenger car

Name: Range Rover, Range Rover Sport

Risk type: Injuries
Category: Motor vehicles
Brand: Land Rover

Type / number of model: Type Approval Number: Range Rover E11*2007/46*0649 Range Rover Sport E11*2007/46*0909

Type of alert: Products with serious risks

Due to a faulty software, the directional indicators may fail to operate when the steering column mounted control stalks are used and the driver does not receive visual or audible warnings if this occurs.

As a consequence, there is an increased risk of a crash.

Recall of the product from end users **Description:** Passenger car.

Batch number / Barcode: Specific vehicles built between 10/11/2017 and 18/12/2018 and fitted with the 4.4L SDV8 diesel engines

Country of origin: United Kingdom **Alert submitted by:** United Kingdom

Products were found and measures were taken also in: Bulgaria, Iceland, Poland

Alert number: A12/0194/19 Product: Passenger car Name: Continental GT Risk type: Injuries Category: Motor vehicles Brand: Bentley

Type / number of model: Type approval numbers: e13*2007/46*0634*01 e13*2007/46*0634*02

Type of alert: Products with serious risks

Due to a software fault a temporary loss of power assistance could occur, requiring the driver to apply additional steering force.

This could lead to an accident.

Recall of the product from end users

Description: Passenger car. Recall code: RE19/02 (RB16)

Batch number / Barcode: Specific vehicles built between 22/01/2018 and 17/12/2018

Country of origin: United Kingdom Alert submitted by: United Kingdom

Products were found and measures were taken also in: Denmark, Romania, Sweden

Alert number: A12/0197/19

Product: Lorry
Name: Unimog
Risk type: Injuries
Category: Motor vehicles
Brand: Mercedes-Benz

Type / number of model: Type-approval numbers: e1*2007/46*1214, *1215, *1216 Types: UGE-452, UGE-232, UGE-453

Type of alert: Products with serious risks

There is a possible damage to the electrical wiring harness.

This may affect the functioning of the rear lighting unit (including trailer), the electrical supply to the cab, the motor control module (MCM) and the

anti-lock braking system (ABS) of the rear axle.

Recall of the product from end users

Description: Lorry

Batch number / Barcode: The vehicles affected were produced between August 2013 and January 2018.

Country of origin: Germany
Alert submitted by: Germany

Products were found and measures were taken also in: Croatia, Slovakia, The Netherlands

Alert number: A12/0198/19

Product: Lorry

Name: 4-, G-, P-, R-series and possibly others

Risk type: Injuries Category: Motor vehicles

Brand: Scania

Type / number of model: EC type-approvals: e4*2007/46*0030, *0031, *0032, *0038, *0039, *0040, *0045, *0046, *0605 and possibly other

types: N320, N321, N322, N330, N331, N332, N340, N341, N351.

Type of alert: Products with serious risks

Defective alignment of the steering geometry, or inadequate alignment of the steering stops, may result in chafing of the wheels on the steering

column.

As a result, the steering column might break, leading to a loss of steering control.

Recall of the product from end users

Description: Lorry

Batch number / Barcode: The vehicles affected were produced between 2007 and June 2017.

Country of origin: Unknown Alert submitted by: Germany

Alert number: A12/0199/19

Product: Bus

Name: Sprinter Transfer, Sprinter Mobility

Risk type: Injuries Category: Motor vehicles

Brand: EvoBus

Type / number of model: EC type-approvals: e13*2007/46*1295, e13*2007/46*1294 Types: KA-UM/UL/UXL-M2, KA-UM/UL/UXL-M3

Type of alert: Products with serious risks

The inbuilt microphone for tour guide announcements is located in the passenger airbag's inflation zone.

If the airbag were activated, it could be damaged.

Recall of the product from end users

Description: Bus

Batch number / Barcode: The vehicles concerned were manufactured between June 2010 and July 2018.

Country of origin: Germany Alert submitted by: Germany

Alert number: A12/0157/19 Product: Smart watch for children

Name: Safe-KID-One Risk type: Other Category: Other **Brand: ENOX**

Type / number of model: Unknown Type of alert: Products with serious risks

The mobile application accompanying the watch has unencrypted communications with its backend server and the server enables unauthenticated access to data. As a consequence, the data such as location history, phone numbers, serial number can easily be retrieved and changed.

A malicious user can send commands to any watch making it call another number of his choosing, can communicate with the child wearing the device or locate the child through GPS.

The product does not comply with the Radio Equipment Directive.

Recall of the product from end users

Description: Smart watch for children in a cardboard box 12x15x8cm, the product was sold online.

Batch number / Barcode: 4260088660947

Country of origin: Germany Alert submitted by: Iceland















Alert number: A12/0057/19 Product: High chair Name: BLÅMES Risk type: Injuries

Category: Childcare articles and children's equipment

Brand: IKEA

Type / number of model: Ref. 50165079, Model: 20948-SUP-ECIS32947

Type of alert: Products with serious risks

The restraint system opens easily and the two adjustments of the belt straps can easily slip off.

As a consequence, a child might fall from the high chair.

The product does not comply with the relevant European Standard EN 14988.

Import rejected at border

Description: Wooden high chair (fibreboard, polypropylene tray), painted with acrylic paint. It comes with a safety belt. Packaging: white

cardboard box.

Batch number / Barcode: 1804 Country of origin: Thailand Alert submitted by: Spain











Alert number: A12/0152/19 **Product:** Toy scooter **Name:** Despicable Me DM3

Risk type: Injuries Category: Toys Brand: illumination

Type / number of model: 808580
Type of alert: Products with serious risks
The scooter is not sufficiently stable.

Children can fall to the ground and hurt themselves.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European Standard EN 71-1.

Destruction of the productImport rejected at border

Description: Pink, 3-wheeled scooter with a little girl and a unicorn printed on the toy.

Batch number / Barcode: Unknown

Country of origin: China
Alert submitted by: France







Alert number: A12/0168/19

Product: Children's fancy-dress costume **Name:** ABYED - Anime Animal Costume Cosplay

Risk type: Choking Category: Toys Brand: Unknown

Type / number of model: Unknown
Type of alert: Products with serious risks
The slider of the zip can be easily detached.
A child could put it in the mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

This product listing was removed by AMAZON, Withdrawal of the product from the market

Description: Fancy-dress costume with hood representing a leopard. It has buttons down the front and a zip at the base of the back. Packed in a

plastic wrapping. The product was sold online .

Batch number / Barcode: Unknown

Country of origin: China
Alert submitted by: France



Alert number: A12/0182/19 **Product:** Pull-along toy

Name: Drewniany piesek na sznurku

Risk type: Strangulation Category: Toys Brand: ECOTOYS

Type / number of model: Item N0. 2205 **Type of alert:** Products with serious risks The cord attached to the toy is too long.

The cord could wrap itself around the child's neck without the child being able to remove it, causing strangulation.


The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Making the marketing of the product subject to prior conditions

Description: Wooden pull along toy in the shape of a dog with cord attached. Packed in a cardboard box.

Batch number / Barcode: 4 894063 031592 Seria 07/2016

Country of origin: China
Alert submitted by: Poland

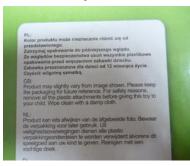







Alert number: A12/0184/19 **Product:** Educational toy

Name: mBot

Risk type: Burns, Chemical

Category: Toys
Brand: Makeblock

Type / number of model: FRA mBot V1.1-Blue (bluethooth version)

Type of alert: Products with serious risks

Due to a short-circuit, the batteries can overheat and the plastic of the battery compartment can melt. Moreover, the battery compartment of the remote-control can easily be opened without use of any tools, giving access to the button cell batteries.

A child may sustain burns from the overheating parts or put the batteries in the mouth and swallow them, which can cause damage to the child's gastrointestinal tract.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standards EN 62115 and EN 71-1. Import rejected at border

Description: Kit for building a blue metal robot, supplied in a cardboard box with markings.

Batch number / Barcode: Unknown

Country of origin: China
Alert submitted by: France

Products were found and measures were taken also in: Denmark, Slovenia



Alert number: A12/0191/19
Product: Squeezable toy
Name: Children's toy
Risk type: Chemical
Category: Toys
Brand: Unknown

Type / number of model: Unknown
Type of alert: Products with serious risks

The plastic material of the product contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 12% by weight) and diisobutyl phthalate (DIBP)

(26% by weight).

These phthalates may harm the health of children causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

Description: Five small, plastic animal toys in a small, transparent plastic bag with cardboard label.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: The Netherlands





Alert number: A12/0195/19

Product: Soft toy

Name: Soft toy turtle, 18 cm Risk type: Chemical, Choking

Category: Toys Brand: Unknown

Type / number of model: Unknown
Type of alert: Products with serious risks

The eyes and the suction cup can easily be detached and the paint on the eyes contains lead (measured value: 63 mg/kg)

The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams.

A small child may put the small parts, the suction cup or the stuffing material in the mouth and choke. Exposure to lead is harmful for human health and can cause developmental neurotoxicity.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standards EN 71-1 and EN 71-3. Withdrawal of the product from the market

Description: Soft toy turtle with green and yellow shell. The product was sold online (in particular on Cdiscount).

Batch number / Barcode: Unknown

Country of origin: China
Alert submitted by: France



Alert number: A12/0196/19 Product: Electric toy Name: Funny microphone Risk type: Environment Category: Toys Brand: Unknown

Type / number of model: NO. 729
Type of alert: Products with serious risks

Four solders in the toy contain lead (measured value up to 44.8% by weight) and two of the four solders contain cadmium (measured value up to 0.66% by weight) in concentrations above limit values.

Lead and cadmium pose a risk to the environment.

The product does not comply with the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Withdrawal of the product from the market

Description: Plastic toy in yellow colour - microphone and bear

Batch number / Barcode: Unknown

Country of origin: China Alert submitted by: Latvia





Alert number: A12/0200/19 Product: Science kit Name: Electro Alarm Risk type: Environment Category: Toys Brand: Alga

Type / number of model: 21928505
Type of alert: Products with serious risks

Solder in one place in the toy contains lead in concentration above limit value (measured value up to 11.7% by weight).

Lead poses a risk to the environment.

The product does not comply with the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Withdrawal of the product from the market

Description: A construction kit for an electric alarm. **Batch number / Barcode:** 4893669285057

Country of origin: China
Alert submitted by: Sweden





Alert number: A12/0165/19 **Product:** Children's dress

Name: Lány ruha

Risk type: Choking, Injuries

Category: Clothing, textiles and fashion items

Brand: Lamond

Type / number of model: 999-0521-3

Type of alert: Products with serious risks

The small decorative rhinestones can easily be detached from the dress.

A small child may put them in the mouth and choke.

The sharp safety pin of the decorative flower is easily accessible.

A small child may put the small parts in the mouth and choke, while the safety pin can cause eye or skin injuries.

Recall of the product from end users, Withdrawal of the product from the market

Description: Pink, sleeveless dress for little girls. The dress is decorated with rhinestones and with textile roses fixed by a safety pin. Size: 92

cm, 2 Years

Batch number / Barcode: Unknown

Country of origin: Turkey
Alert submitted by: Hungary











Alert number: A12/0166/19 Product: Babies' clothing set

Name: Unknown Risk type: Choking

Category: Clothing, textiles and fashion items

Brand: Petite Ponpon Baby
Type / number of model: Unknown
Type of alert: Products with serious risks

The small decorative elements of the product may be easily detached.

A small child may put them in the mouth and choke.

Recall of the product from end users, Withdrawal of the product from the market

Description: Sets of white clothing for newborn babies consisting of a cap, a rompersuit and mittens. The products are decorated with embroidered angel wings and bows with rhinestones. The decorative elements can be in blue or pink colours. Sample size: 56 cm

Batch number / Barcode: Unknown

Country of origin: Turkey
Alert submitted by: Hungary









Alert number: A12/0169/19 Product: Ladies' sandals Name: Damen Pantolette Risk type: Chemical

Category: Clothing, textiles and fashion items

Brand: ElleNor

Type / number of model: Unknown
Type of alert: Products with serious risks

The amount of chromium (VI) in the leather of the insoles is too high (measured value 12.4 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions.

The product does not comply with the REACH Regulation.

Recall of the product from end users

Description: Ladies' sandals with two, approx. 3.5 cm-wide, crossed straps made of synthetic material over the instep of the foot; insoles made

of light-brown leather. Available in sizes 37-40 in black/silver.

Batch number / Barcode: 4039653754509

Country of origin: China
Alert submitted by: Germany

Products were found and measures were taken also in: France









Alert number: A12/0186/19 **Product:** Children's sweatshirt

Name: Deška jopa Risk type: Strangulation

Category: Clothing, textiles and fashion items

Brand: RITCHIE JEANS CO

Type / number of model: RT7394X, Reference: WIPACK J

Type of alert: Products with serious risks There are drawstrings with free ends in the hood.

The drawstrings may become trapped during various activities of the child, leading to strangulation.

The product does not comply with the relevant European standard EN 14682.

Making the marketing of the product subject to prior conditions

Description: Children's sweatshirt with drawstring with free ends in the hood; intended for 10-year old children.

Batch number / Barcode: 3660283413408

Country of origin: Unknown Alert submitted by: Slovenia











Alert number: A12/0187/19

Product: Children's sweatshirt

Name: Deška jopa Risk type: Strangulation

Category: Clothing, textiles and fashion items

Brand: LONGBOARD

Type / number of model: JUST MUVE, Reference 46974000

Type of alert: Products with serious risks There are drawstrings with free ends in the hood.

The drawstrings may become trapped during various activities of the child, leading to strangulation.

The product does not comply with the relevant European standard EN 14682.

Making the marketing of the product subject to prior conditions

Description: Children's sweatshirt with drawstrings with free ends in the hood; intended for 10-year old children.

Batch number / Barcode: 3253538179817

Country of origin: Unknown Alert submitted by: Slovenia









Alert number: A12/0173/19

Product: Hair dye
Name: Hair Color
Risk type: Chemical
Category: Cosmetics
Brand: Color Mate

Type / number of model: Light Brown 9.7 Type of alert: Products with serious risks

The product contains barium (measured value: 13.6 % by weight) as peroxide.

Barium peroxide is corrosive and irritant. Barium can be absorbed from the dye and have toxic effects on kidney and heart.

The product contains too much p-aminophenol (measured value: 13.6% by weight, final calculated concentration: 3.8%) and insufficient coupling

Uncoupled p-aminopohenol is a strong skin sensitiser and may trigger allergic skin reactions.

The product does not comply with the Cosmetic Products Regulation.

Destruction of the product

Description: Hair dye powder (light brown colour), packed in an aluminium sachet containing 15 g. Sold in a printed cardboard box containing 5 sachets.

Batch number / Barcode: 8 906016 050843 Batch Number: 07

Country of origin: India

Alert submitted by: Germany









Alert number: A12/0153/19 Product: USB-Charger

Name: Samsung EP-TA20EWE (Counterfeit)

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Samsung (Counterfeit)

Type / number of model: EP-TA20EWE Type of alert: Products with serious risks

The electrical insulation and the clearance/creepage distances between the primary and accessible secondary circuit are not sufficient.

The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Withdrawal of the product from the market

Description: Black Charger provided in a plastic bag.

Batch number / Barcode: Unknown THE PRODUCT IS COUNTERFEIT

Country of origin: China
Alert submitted by: Sweden





Alert number: A12/0154/19 Product: USB-Charger Name: EP-TA20EWE Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Unknown

Type / number of model: EP-TA20EWE
Type of alert: Products with serious risks

The electrical insulation and the clearance /creepage distances between the primary and accessible secondary circuit are not sufficient.

The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Withdrawal of the product from the market

Description: White USB-Charger provided in a plastic bag

Batch number / Barcode: 86696806738

Country of origin: China Alert submitted by: Sweden





Alert number: A12/0155/19 Product: USB-Charger Name: Unknown

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Unknown

Type / number of model: keke-f5
Type of alert: Products with serious risks

The electrical insulation and the clearance/creepage distances between the primary and accessible secondary circuit are not sufficient.

The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Withdrawal of the product from the market

Description: White USB-charger with purple stripe provided in a plastic bag

Batch number / Barcode: Unknown

Country of origin: China
Alert submitted by: Sweden







Alert number: A12/0156/19 Product: USB-Charger Name: Unknown

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Unknown

Type / number of model: EP-TA20JWE
Type of alert: Products with serious risks

The electrical insulation and the clearance/creepage distances between the primary and accessible secondary circuit are not sufficient.

The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Withdrawal of the product from the market

Description: White USB-charger provided in a plastic bag **Batch number / Barcode:** S/N R37G15Z7JP1RT3

Country of origin: China
Alert submitted by: Sweden



